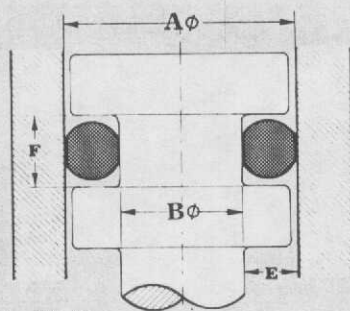


Tabelle IX

P.R.P. O-Ringe						Nutabmessungen					Rac
Bohrung Ø	Teil-Nr.	Innen Ø		Schnurdicke		NutgrundØ		Nutbreite ohne Stützring	1 Stützring	2 Stützringe	ohr Stu ring
A		ID	Tol.	W	Tol.	B	Tol.				R1
mm		mm	± mm	mm	± mm	mm	-mm	Fmm	F ₁ mm	F ₂ mm	R1
50	032	47.35	0.38	1.78	0.08	47.10	0.05	2.2	3.6	5.0	0
	132	44.12	0.38	2.62	0.08	45.50	0.10	3.1	4.5	5.9	0
	224	44.04	0.38	3.53	0.10	43.80	0.10	4.2	5.6	7.0	1
	326	40.64	0.38	5.33	0.13	40.60	0.15	6.2	7.9	9.6	1
52	032	47.35	0.38	1.78	0.08	49.10	0.05	2.2	3.6	5.0	0
	133	45.69	0.38	2.62	0.08	47.50	0.10	3.1	4.5	5.9	0
	224	44.04	0.38	3.53	0.10	45.80	0.10	4.2	5.6	7.0	1
	326	40.64	0.38	5.33	0.13	42.60	0.15	6.2	7.9	9.6	1
55	033	50.52	0.46	1.78	0.08	52.10	0.05	2.2	3.6	5.0	0
	135	48.90	0.43	2.62	0.08	50.50	0.10	3.1	4.5	5.9	0
	225	47.22	0.46	3.53	0.10	48.80	0.10	4.2	5.6	7.0	1
	327	43.82	0.38	5.33	0.13	45.60	0.15	6.2	7.9	9.6	1
58	034	53.70	0.46	1.78	0.08	55.10	0.05	2.2	3.6	5.0	1
	137	52.07	0.43	2.62	0.08	53.50	0.10	3.1	4.5	5.9	0
	226	50.39	0.46	3.53	0.10	51.80	0.10	4.2	5.6	7.0	1
	328	49.99	0.38	5.33	0.13	48.60	0.15	6.2	7.9	9.6	1
60	035	56.87	0.46	1.78	0.08	57.10	0.05	2.2	3.6	5.0	0
	139	55.25	0.43	2.62	0.08	55.50	0.10	3.1	4.5	5.9	0
	227	53.57	0.46	3.53	0.10	53.80	0.10	4.2	5.6	7.0	1
	329	50.17	0.46	5.33	0.13	50.60	0.15	6.2	7.9	9.6	1
63	036	60.05	0.46	1.78	0.08	60.10	0.05	2.2	3.6	5.0	0
	141	58.42	0.51	2.62	0.08	58.50	0.10	3.1	4.5	5.9	0
	228	56.74	0.51	3.53	0.10	56.80	0.10	4.2	5.6	7.0	1
	330	53.34	0.46	5.33	0.13	53.60	0.15	6.2	7.9	9.6	1
65	036	60.05	0.46	1.78	0.08	62.10	0.05	2.2	3.6	5.0	0
	141	58.42	0.51	2.62	0.08	60.50	0.10	3.1	4.5	5.9	0
	228	56.74	0.51	3.53	0.10	58.80	0.10	4.2	5.6	7.0	1
	330	53.34	0.46	5.33	0.13	55.60	0.15	6.2	7.9	9.6	1